

Unable to cock or recock bolt






POSSIBLE CAUSE: Dirt in the receive body.

SOLUTION: Cleaning internals of marker.



POSSIBLE CAUSE: Striker O-Ring is damaged.

SOLUTION: Replace striker O-Ring and apply lubrication.

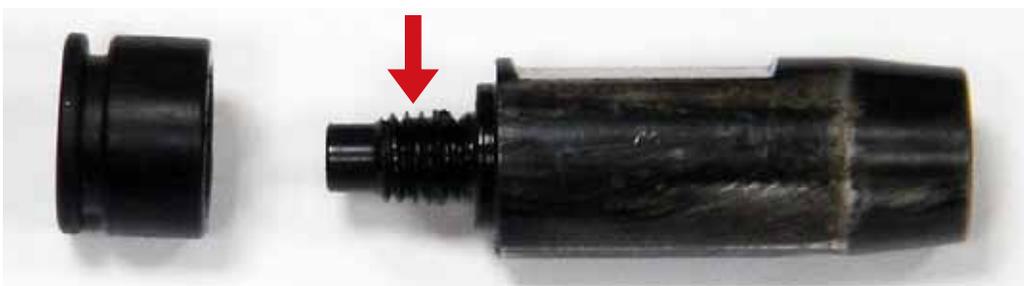

POSSIBLE CAUSE: Delrin Cap is loose from Feather Striker.

SOLUTION: Apply Loctite to lock the Derlin Cap with Steel Main body.



LOCTITE



POSSIBLE CAUSE: Cup seal or cup seal guide is damaged or loose.

SOLUTION: Replaced cup seal or cup seal guide/ Apply Loctite on the threaded side of cup seal guide. Loctite needs 24 hrs to completely dry.



LOCTITE




POSSIBLE CAUSE: Sear is damaged.

SOLUTION: Replace striker sear.



POSSIBLE CAUSE: Incorrect setting on regulator.

SOLUTION: Restor the regulator to stock setting - turn the screw all the way in and back up 4~4 1/2 out (for HPA user).

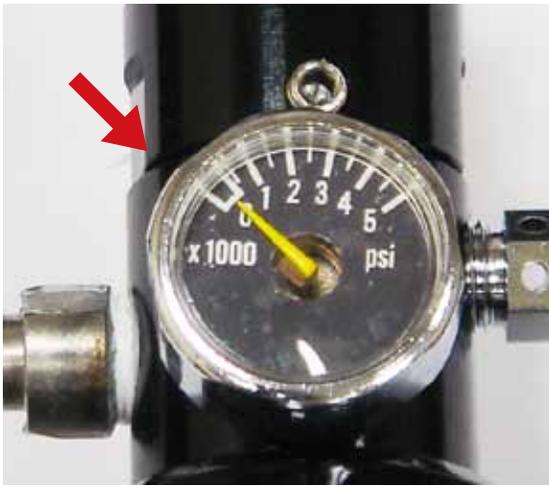

POSSIBLE CAUSE: insufficient air supply (HPA).

SOLUTION: Fill up the HPA Tank (> 1000 PSI).