

Unable to cock or recock bolt






POSSIBLE CAUSE: Dirt in the receiver body.

SOLUTION: Cleaning internals of marker



POSSIBLE CAUSE: Striker O-Ring is damaged.

SOLUTION: Replace striker O-Ring and apply lubrication.

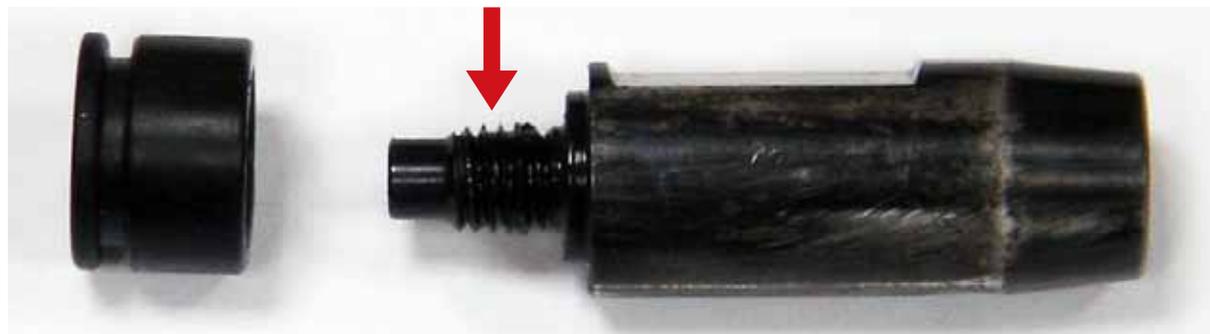

POSSIBLE CAUSE: Delrin Cap is loose from Feather Striker.

SOLUTION: Apply Loctite to lock the Delrin Cap with Steel Main body and leave 24 hours to dry.



LOCTITE



POSSIBLE CAUSE: Cup seal or cup seal guide is damaged or loose.

SOLUTION: Replaced cup seal or cup seal guide/ Apply Loctite on the threaded side of cup seal guide. Loctite needs 24 hrs to completely dry.



LOCTITE



POSSIBLE CAUSE: Sear is damaged.

SOLUTION: Replace striker sear.



POSSIBLE CAUSE: insufficient air supply (HPA)

SOLUTION: Fill up the HPA Tank (> 1000 PSI)